

**NARRATIVE**

This survey was performed at the request of Mr. Durell Farnsworth for the purpose of locating the Southeast Corner of the NW1/4 of the NW1/4 (Lot 1) of Section 18 and surveying in the positions of the old existing fence and the newer fence as constructed by Mr. Kim Lindsay.

This section was originally surveyed using the "3-mile method" by the General Land Office in 1882 during which time the quarter-quarter corners (a.k.a. 1/16 corners) were set. A search was made around the perimeter of Lot 1. Monument spikes were found in the county roads at the SW, NW, and NE corners of this quarter-quarter section. The Southeast corner was missing. A search of the next 1/4 mile east found an old existing north-south fence very close to the record distance from the west section line. This fence was used to control the east-west position of this quarter-quarter corner. No evidence was found at the next 1/4 mile east. Old existing right-of-way fences were found at the east section line and taken together with the position of the Northeast section corner were used to determine the east-west position of the SE corner of the NE1/4 of the NE1/4 of said section. In addition, an old east-west fence was found continuing east from this corner and was used to establish the north-south position of this corner. With this corner reestablished the bearing from it to the monument spike found at the SW corner of Lot 1 was used to fix the north-south positions of the quarter-quarter corners along this line. The Southeast Corner of Lot 1 was then determined by single proportionate measure along this line between the found monument spike and the old existing fence found at the center of the section. The relationships of the measured distances between these reestablished points compared to the record dimensions on the G.L.O. plat for this quarter-quarter line agree remarkably close. The area between the quarter-quarter line and the old fence was then determined as shown on the plat.

The Mountain Home Townsite was created in 1913 and was laid out with right angles to the west line of Lots 1 and 2 of Section 18 and tied to the Northwest Corner of the section. Several old lot line fences were found and tied to the present survey (corner posts were surveyed in as shown on the plat) to help show the relationship of the townsite to the quarter-quarter lines because of the many conflicting elements in the property descriptions along the east line of the townsite. The resolution of these conflicts is beyond the scope of this project.

**LEGEND AND NOTES**

- G.L.O. INDICATES RECORD DISTANCE FROM GENERAL LAND OFFICE SURVEY PLAT OF 1882
- ◆ MONUMENT SPIKE FOUND BY THIS SURVEY
- 5/8"x24" REBAR WITH ALUM CAP SET BY THIS SURVEY
- FOUND OLD CORNER POST IN TOWNSITE SURVEY


THIS SURVEY WAS PERFORMED USING GLOBAL POSITIONING SYSTEM (G.P.S.) PROCEDURES AND EQUIPMENT. THE BEARINGS ARE BASED ON WGS84 DATUM.

**SURVEYOR'S CERTIFICATE**

This is to certify that I have surveyed the parcel shown on this plat, and that the monuments indicated were found or set during said survey, and that this plat accurately represents said survey to the best of my knowledge.



Jerry D. Allred, Duchesne County Surveyor  
Utah Certificate Number 148951

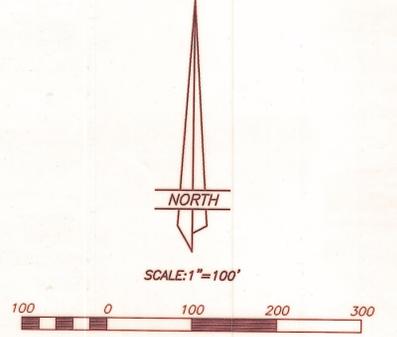

**FENCE LOCATION SURVEY FOR  
DURELL FARNSWORTH  
SECTION 18, TOWNSHIP 1 SOUTH, RANGE 4 WEST  
UINTAH SPECIAL BASE AND MERIDIAN**

**JERRY D. ALLRED AND ASSOCIATES**  
SURVEYING CONSULTANTS  
121 NORTH CENTER ST., -P.O. BOX 975  
DUCHESTER, UTAH 84021  
(435) 738-5352

1 JUL 2002 02-100-063